


南相馬 改良後「コーンα」BPによる線量総括表

経過日数 種別	試験前 0日目線量 μsv/h	7月6日 7日目線量 μsv/h	7月14日 15日目線量 μsv/h	7月29日 30日目線量 μsv/h	8月31日 61日目線量 μsv/h	9月29日 90日目線量 μsv/h	11月2日 127日目線量 μsv/h	11月29日 154日目線量 μsv/h	12月21日 174日目線量 μsv/h	1月25日 209日目線量 μsv/h	2月25日 240日目線量 μsv/h	3月30日 273日目線量 μsv/h	4月27日 301日目線量 μsv/h	5月25日 329日目線量 μsv/h	6月28日 364日目線量 μsv/h	H30.6.27 722日目線量 μsv/h
エリア空間線量平均	0.216	0.333	0.284	0.489	0.335	0.421	0.430	0.390	0.364	0.305	0.353	0.307	0.285	0.324	0.285	0.285
改良A工区 改良箇所平均 α300gBP30g 定点変化	0.716	0.541	0.565	0.544	0.542	0.524	0.516	0.499	0.491	0.488	0.487	0.459	0.462	0.432	0.435	0.391
改良B工区 改良箇所平均 α300gBP30g 定点変化	1.061	0.582	0.611	0.613	0.517	0.514	0.516	0.478	0.459	0.441	0.445	0.436	0.426	0.417	0.437	0.367
GL+0.01m測定 目標線量値 0.23μ	天候:曇り	天候:曇り	天候:曇り	天候:晴れ	天候:晴れ	天候:雨天	天候:晴れ	天候:晴れ	天候:晴れ	天候:晴れ	天候:晴れ	天候:晴れ	天候:晴れ	天候:晴れ	天候:雨	天候:晴れ 天候:曇り/雨

南相馬「コーンα」BPによる改良後線量変化（測定平均値）

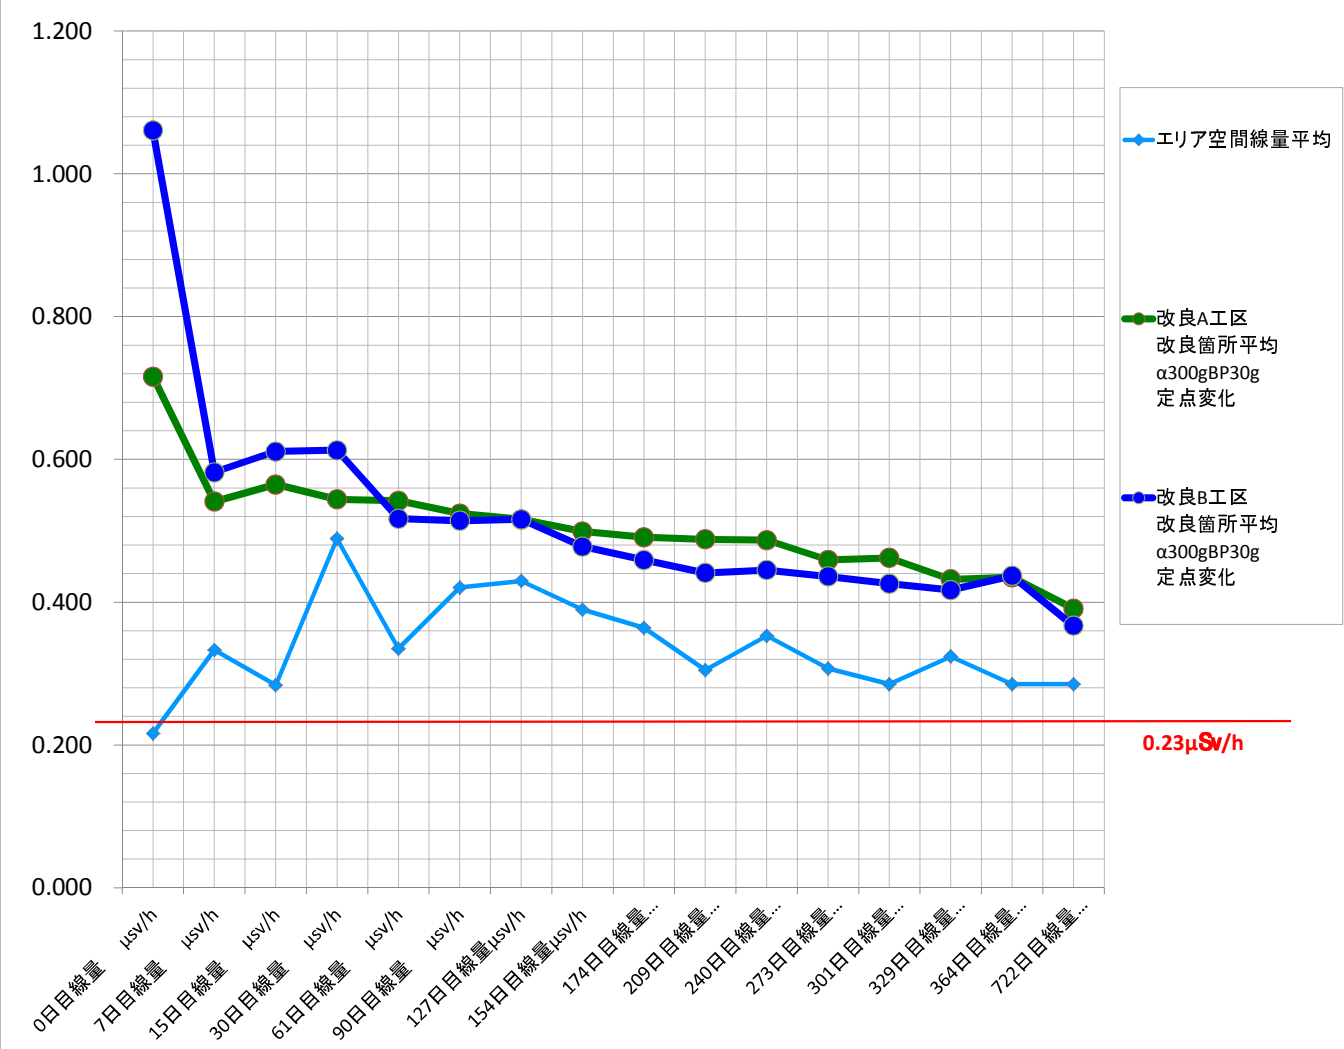

平成30年6月27日
722日目線量

測定記録写真

A工区

空間線量GL+1m
0.251

0.302-0.365 $\mu\text{sv/h}$
0.239

0.257

0.266

0.258



$(0.251+0.239+0.257+0.266+0.258)/5$
0.254 $\mu\text{sv/h}$

A工区

未改良 No.a 土地盤



0.563-0.587 $\mu\text{sv/h}$

0.582

0.581

0.587

0.563



未改良 No.b 土地盤



0.396-0.453 $\mu\text{sv/h}$

0.396

0.404

0.453

0.43



未改良 No.c 碎石地盤



0.637-0.643 $\mu\text{sv/h}$

0.637

0.643

0.641

0.643



未改良 No.d 土地盤



0.214-0.357 $\mu\text{sv/h}$

0.214

0.221

0.357

0.278



未改良 No.e 土地盤



0.434-0.453 $\mu\text{sv/h}$

0.434

0.439

0.453

0.443





未改良	No.f	土地盤
-----	------	-----



0.528-0.542 $\mu\text{sv/h}$
0.492 0.5 0.514 0.492



未改良	No.g	土地盤
-----	------	-----



0.897-0.922 $\mu\text{sv/h}$
0.897 0.908 0.922 0.898



未改良	No.h	アスコン道路
-----	------	--------



0.202-0.251 $\mu\text{sv/h}$
0.202 0.205 0.251 0.22



未改良	No.i	アスコン苔
-----	------	-------




0.305-0.313 $\mu\text{sv/h}$
0.308 0.313 0.312 0.305



未改良	No.j	畦
-----	------	---



0.334-0.370 $\mu\text{sv/h}$
0.334 0.343 0.37 0.342

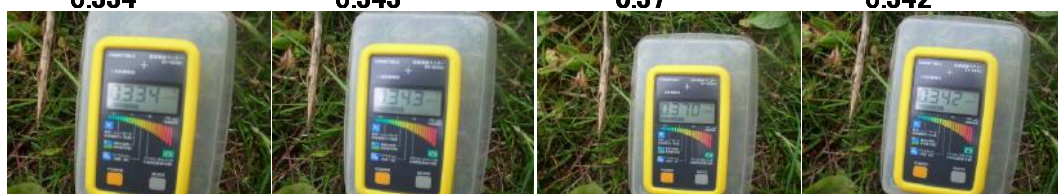

未改良	No.k	アスコンクラック
-----	------	----------



0.534-0.553 $\mu\text{sv/h}$
0.534 0.537 0.553 0.545



未改良	No.1	碎石道路
-----	------	------



0.198-0.211 $\mu\text{sv/h}$
 0.198 0.2 0.211 0.205



改良	No.1
----	------



0.220-0.239 $\mu\text{sv/h}$
 0.229 0.239 0.238 0.22



改良	No.2
----	------



0.251-0.267 $\mu\text{sv/h}$
 0.252 0.267 0.252 0.251



改良	No.3
----	------



0.312-0.447 $\mu\text{sv/h}$
 0.312 0.447 0.416 0.362



改良	No.4
----	------



0.557-0.616 $\mu\text{sv/h}$
 0.587 0.616 0.557 0.557



改良	No.5
----	------



0.497-0.563 $\mu\text{sv/h}$
 0.497 0.53 0.563 0.536



改良 No.6



0.249 0.249-0.257 $\mu\text{sv/h}$ 0.255 0.257 0.253



改良 No.7



0.222 0.222-0.239 $\mu\text{sv/h}$ 0.239 0.234 0.229



改良 No.8



0.35 0.298-0.455 $\mu\text{sv/h}$ 0.455 0.409 0.298



改良 No.9



0.505 0.485-0.515 $\mu\text{sv/h}$ 0.515 0.493 0.485



改良 No.10



0.471 0.471-0.489 $\mu\text{sv/h}$ 0.489 0.48 0.475



改良 No.11




0.203 0.200-0.204 $\mu\text{sv/h}$ 0.204 0.201 0.2



改良	No.12
----	-------



0.319 0.234-0.385 μ sv/h 0.385 0.284 0.234

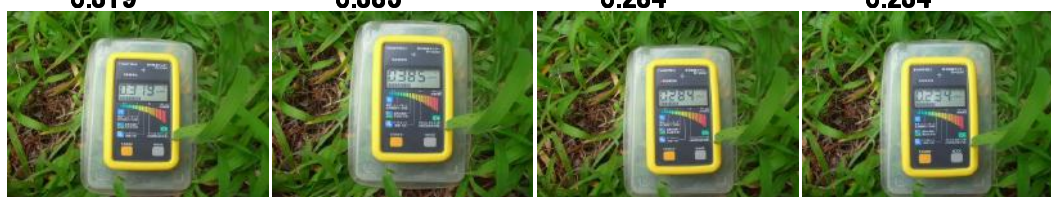

改良	No.13
----	-------



0.452 0.452-0.469 μ sv/h 0.468 0.469 0.46



改良	No.14
----	-------



0.365 0.356-0.385 μ sv/h 0.385 0.378 0.356



改良	No.15
----	-------



0.296 0.296-0.333 μ sv/h 0.328 0.333 0.317



平成30年6月27日
722日目線量

測定記録写真

B工区

空間線量GL+1m
0.273

0.273-0.340 $\mu\text{sv/h}$
0.277

0.309 $\mu\text{sv/h}$
0.319

0.334

0.34



B工区

未改良	No.a	土地盤
-----	------	-----

0.284

0.3

0.247-0.300 $\mu\text{sv/h}$
0.254

0.247



未改良	No.b	碎石舗装
-----	------	------

0.183

0.19

0.181-0.214 $\mu\text{sv/h}$
0.181

0.214



未改良	No.c	土法地盤
-----	------	------

0.429

0.44

0.429-0.440 $\mu\text{sv/h}$
0.438

0.437






未改良	No.c'	土地盤
-----	-------	-----

0.451

0.467

0.444-0.467 $\mu\text{sv/h}$
0.454

0.444

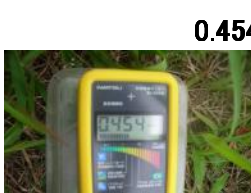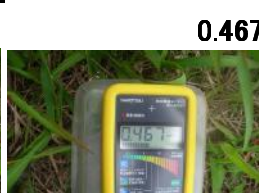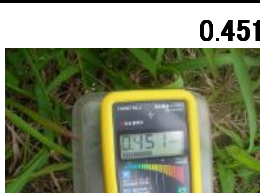

未改良	No.d	土地盤
-----	------	-----

0.625

0.635

0.659-0.695 $\mu\text{sv/h}$
0.631

0.624






改良	No.4
----	------



改良	No.5
----	------

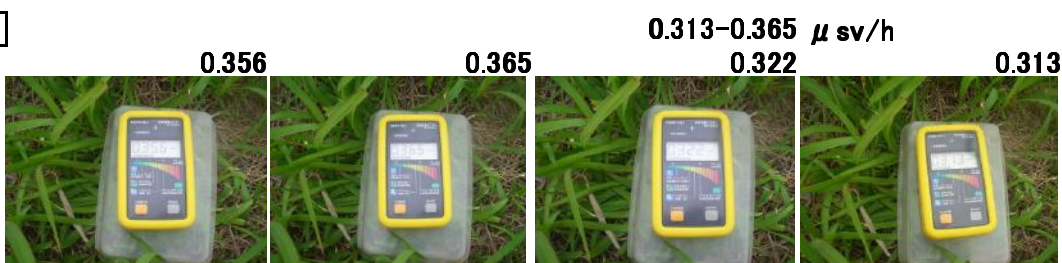

改良	No.6
----	------

